


THE PRESTON PARTNERSHIP, LLC A MULTI-DISCIPLINARY DESIGN FIRM

SOUTH TERRACES 115 PERIMETER CENTER PLACE, SUITE 950 ATLANTA, GEORGIA 30346 TELEPHONE: 770 396 7248 FAX: 770 396 2945

WWW.THEPRESTONPARTNERSHIP.COM



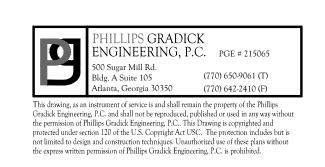

REVEL AT THE BALLPARK PHASE II 2885 CRESCENT PKWY

SMYRNA, GA 30080




ATLANTIC REALTY **PARTNERS**

3438 PEACHTREE ROAD **SUITE 1425** ATLANTA, GA 30326

ISSUES & #\ REVISIONS	DATE	
CONCEPTUAL DESIGN	8/21/15	
SD PROGRESS SET	09/28/15	
GMP PRICING SET	10/14/15	
FOUNDATION PACKAGE	12/07/15	
GMP PACKAGE	04/03/17	
PERMIT SET	05/22/17	
⚠ PERMIT REVISIONS	10/02/2017	

<u>REVISION #5 SUMMARY — PERMIT REVISIONS</u>

1. REVISION DUE TO ARCH BACKGROUND CHANGE. REMOVED WALL HEATER.

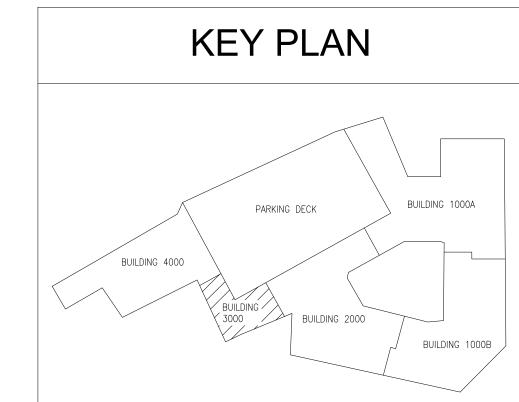

DATE	05/22/201
JOB NUMBER	149310
DRAWN BY -	L[
CHECKED BY	CMC
SHEET TITLE	
ם ווו ם	INIC 2000 DDO IECT

BUILDING 3000 PROJECT -LEVEL 3

M1-33

30X42 © 2017 The Preston Partnership, LLC

NOTES:

<u>KEY NOTES:</u>

1 TOILET EXHAUST OUTLET.

2 DRYER EXHAUST VENT OUTLET.

1. SEE SHEET M3.XX FOR APARTMENT HVAC.

2. UNLESS NOTED OTHERWISE, ALL CEILINGS ARE PART OF A RATED FLOOR/CEILING ASSEMBLY, AND REQUIRE A CEILING RADIATION DAMPER (CRD) AT EACH PENETRATION OF CEILING.

3. FOR MECHANICAL SYSTEMS SERVING THE CORRIDORS, THE O.A. INTAKE

LOUVER SHALL BE INSTALLED A MINIMUM OF 10'-0" FROM APARTMENT UNITS TOILET EXHAUST. ADJUST TERMINATION POINT OF EXHAUST DUCTS AS NECESSARY FOR EACH APARTMENT UNIT.

4. ALTERNATE ROUTING OF DRYER AND TOILET EXHAUST DUCT IN APARTMENT UNITS SHOWN HERE, TO AVOID CONFLICT WITH 10'-0" CLEARANCE REQUIREMENT FROM CORRIDOR OUTDOOR AIR INTAKE.

5. APARTMENT UNIT WINDOWS OPEN SO THAT THE TOP OF OPENING IS AT 5'-0" A.F.F. EXHAUST TERMINATIONS ARE LOCATED ABOVE THE CEILING OF

APARTMENTS WHICH IS LOCATED AT 9'-0" A.F.F. THIS CREATES A MINIMUM

(3) O.A. INTAKE INLET. MAINTAIN 10'-0" FROM ANY EXHAUST OUTLET AS SHOWN ON THESE PLANS.

4'-0" CLEAR FROM BUILDING OPENING TO A VENT CAP.